

Date: Wednesday, 03/09/2008 10:32:43 AM
 User: Julie Lecocq

Process Sheet

Customer : CU-DAR001 Dart Helicopters Services Drawing Name : AFT TUBE ASSEMBLY
 Job Number : 41755
 Estimate Number : 10699
 P.O. Number :
 This Issue : 03/09/2008 S.O. No. :
 Prsht Rev. : NC
 First Issue : / / Type : SKIDTUBES
 Previous Run : 41754
 Part Number : D3391025
 Drawing Number : D3391 REV G
 Project Number : N/A
 Drawing Revision : G
 Material :
 Due Date : 20/09/2008 Qty: 1 Um: Each

Written By :
 Checked & Approved By : JLD 08.09.03
 Comment : Est Rev B 06-02-07 ECN773 dwg rev. D EC
 Est Rev:C 06-03-28 Update Manuf. Instructions JLM

est rev D 07.03.20 revF dwg EC
 est rev E 07.11.07 rev G dwg ecn 1053p EC verified by:
 DD
 Est Rev:F 07-11-13 ECN 1056 DD verified by: EC

Additional Product

Job Number:



Seq. #: Machine Or Operation: Description :

1.0 D6014090 ALUMINUM EXTRUSION



Comment: Qty.: 1.0000 f(s)/Unit Total : 1.0000 f(s)

ALUMINUM EXTRUSION

Pick:

Qty	Part Number	Description	Batch
1	D6014-090	Extrusion	<u>B32309</u>

Identify as D3391-3

A.M 08.09.11 (7)

2.0 MORI SEIKI MORI SEIKI CNC LATHE LARGE



Comment: MORI SEIKI CNC LATHE LARGE

Turn as per Folio FA599 Rev: AA & Dwg D3391 Rev: G A.M 08.09.11 (7)

3.0 QC2 INSPECT PARTS AS THEY COME OFF MACHINE



Comment: INSPECT PARTS AS THEY COME OFF MACHINE

A.M 08.09.11 (7)

4.0 HAAS1 HAAS CNC VERTICAL MACHINING #1



Comment: HAAS

1-Machine as per Folio FA 599 Rev: AA & Dwg D3391 Rev: G

2-Deburr

N.A 08/09/23

PD 08/09/22

W/O:		WORK ORDER CHANGES					
DATE	STEP	PROCEDURE CHANGE	By	Date	Qty	Approval Chief Eng / Prod Mgr	Approval QC Inspector

Part No: _____ PAR #: _____ Fault Category: _____ NCR: Yes No DQA: _____ Date: _____

Resolution: _____ Disposition: _____ QA: N/C Closed: _____ Date: _____

NCR:		WORK ORDER NON-CONFORMANCE (NCR)						
DATE	STEP	Description of NC Section A	Corrective Action Section B			Verification Section C	Approval Chief Eng	Approval QC Inspector
			Initial Chief Eng	Action Description Chief Eng	Sign & Date			

NOTE: Date & initial all entries

Date: Wednesday, 03/09/2008 10:32:43 AM
User: Julie Lecocq

Process Sheet

Customer: CU-DAR001 Dart Helicopters Services

Drawing Name: AFT TUBE ASSEMBLY

Job Number: 41755

Part Number: D3391025

Job Number:



Seq. #:

Machine Or Operation:

Description:

5.0

QC2

INSPECT PARTS AS THEY COME OFF MACHINE



Comment: INSPECT PARTS AS THEY COME OFF MACHINE

M.A 08/09/23

6.0

QC8

SECOND CHECK



Comment: SECOND CHECK

mk 08/09/28

②

7.0

SKIDTUBES 1

SKIDTUBESS RESOURCE 1



Comment: LANDING GEAR RESOURCE 1

1-Drill (PILOT HOLE) aft cap holes per Dwg D3391 using DT8803

SL 8-10-3

8.0

BENDING

BENDING MACHINE - SKIDTUBES



Comment: NC Bender

Form as per Dwg D3391 Using Bend Prog 3391025

25 08-10-03

9.0

QC5

INSPECT WORK TO CURRENT STEP



Comment: INSPECT WORK TO CURRENT STEP

DP

8-10-3

10.0

SKIDTUBES 1

SKIDTUBESS RESOURCE 1



Comment: LANDING GEAR RESOURCE 1

1-Open Aft cap pilot hole to .208" as per Dwg D3391

2-Drill float bag holes using DT8809 as per Dwg D3391(Holes marked "A" Only.

3-Drill wearplate holes as per Dwg D3391 using DT8878(Mid Tube) & DT8217 Wearplate Jig.

*****Do Not Open To Finished Size*****

4-Drill Wearshoe holes as per DWG D3391 using DT8939 locating from 2 previously drilled aft wearplate holes.

5-Open wearplate holes to .0.250" and c'bore as per dwg D3391

6-Open up all wearshoe, wearplate to 0.297" and float bag holes to 0.328" as per Dwg D3391.

7-Deburr

Tools: rill

SL 8-11-2

W/O:		WORK ORDER CHANGES					
DATE	STEP	PROCEDURE CHANGE	By	Date	Qty	Approval Chief Eng / Prod Mgr	Approval QC Inspector

Part No: _____ PAR #: _____ Fault Category: _____ NCR: Yes No DQA: _____ Date: _____

Resolution: _____ Disposition: _____ QA: N/C Closed: _____ Date: _____

NCR:		WORK ORDER NON-CONFORMANCE (NCR)						
DATE	STEP	Description of NC Section A	Corrective Action Section B			Verification Section C	Approval Chief Eng	Approval QC Inspector
			Initial Chief Eng	Action Description Chief Eng	Sign & Date			

NOTE: Date & initial all entries

Date: Wednesday, 03/09/2008 10:32:43 AM
User: Julie Lecocq

Process Sheet

Customer: CU-DAR001 Dart Helicopters Services

Drawing Name: AFT TUBE ASSEMBLY

Job Number: 41755

Part Number: D3391025

Job Number:



Seq. #:

Machine Or Operation:

Description :

11.0

QC5

INSPECT WORK TO CURRENT STEP



08-11-03 (1)



Comment: INSPECT WORK TO CURRENT STEP

12.0

HAND FINISHING1

HAND FINISHING RESOURCE #1



AUM 8-11-04



Comment: HAND FINISHING RESOURCE #1

Acid etch and Alodine as per QSI 005 4.1

13.0

QC3

INSPECT POWDER COAT/CHEMICAL CONVERSION



Comment: INSPECT POWDER COAT/CHEMICAL CONVERSION

AUM 08-11-04 (1)

14.0

D36704200

SPACER



Comment: Qty.: 4.0000 Each(s)/Unit Total: 4.0000 Each(s)

SPACER

batch: 36816

X(4)

SL 8-11-24

15.0

SKIDTUBES 1

SKIDTUBESS RESOURCE 1



Comment: LANDING GEAR RESOURCE 1

Instal spacers as per dwg D3391

A/R Magnabond 6398 Batch: 108966

exp. date: 9-10-1

cure time 12hrs as per QSI0015

SL 8-11-24
H6

16.0

QC5

INSPECT WORK TO CURRENT STEP



Comment: INSPECT WORK TO CURRENT STEP

S 08/11/20 (10)

17.0

POWDER COATING

POWDER COATING



M 109152



(1X)

Comment: POWDER COATING

Powder Coat White Gloss (Ref: 4.3.5.1) as per QSI 005 4.3

START TIME: 11:40

OVEN TEMPERATURE: 320 OF

FINISH TIME: 12:10

M. H 08/11/20

W/O:		WORK ORDER CHANGES					
DATE	STEP	PROCEDURE CHANGE	By	Date	Qty	Approval Chief Eng / Prod Mgr	Approval QC Inspector

Part No: _____ PAR #: _____ Fault Category: _____ NCR: Yes No DQA: _____ Date: _____

Resolution: _____ Disposition: _____ QA: N/C Closed: _____ Date: _____

NCR:		WORK ORDER NON-CONFORMANCE (NCR)						
DATE	STEP	Description of NC Section A	Corrective Action Section B			Verification Section C	Approval Chief Eng	Approval QC Inspector
			Initial Chief Eng	Action Description Chief Eng	Sign & Date			

NOTE: Date & initial all entries

Date: Wednesday, 03/09/2008 10:32:43 AM
User: Julie Lecocq

Process Sheet

Customer: CU-DAR001 Dart Helicopters Services

Drawing Name: AFT TUBE ASSEMBLY

Job Number: 41755

Part Number: D3391025

Job Number:



Seq. #:

Machine Or Operation:

Description :

18.0

QC3

INSPECT POWDER COAT/CHEMICAL CONVERSION



JS



Comment: INSPECT POWDER COAT/CHEMICAL CONVERSION

09.02.26

(X.1)

19.0

D2646

Aft Cap



Comment: Qty.: 1.0000 Each(s)/Unit Total : 1.0000 Each(s)

Aft Cap

Pick:

Qty	Part Number	Description	Batch
1	D2646	Aft Cap	B413801

B413801

JS

20.0

D35371

Wearpad



Comment: Qty.: 1.0000 Each(s)/Unit Total : 1.0000 Each(s)

WEARPAD B45352

JS

21.0

D35377

Wearpad



Comment: Qty.: 1.0000 Each(s)/Unit Total : 1.0000 Each(s)

Wearpad B333869

22.0

D35531

Gasket



Comment: Qty.: 1.0000 Each(s)/Unit Total : 1.0000 Each(s)

Gasket B31630

JS

23.0

D35533

Gasket



Comment: Qty.: 1.0000 Each(s)/Unit Total : 1.0000 Each(s)

Gasket B333870

JS

24.0

D36721

Phenolic Washer



Comment: Qty.: 2.0000 Each(s)/Unit Total : 2.0000 Each(s)

PHENOLIC WASHER

B39275

JS

25.0

ALS41032130

Insert



Comment: Qty.: 14.0000 Each(s)/Unit Total : 14.0000 Each(s)

INSERT

batch: M108606

X

JS

09.03.10

(X.2)

W/O:		WORK ORDER CHANGES					
DATE	STEP	PROCEDURE CHANGE	By	Date	Qty	Approval Chief Eng / Prod Mgr	Approval QC Inspector

Part No: _____ PAR #: _____ Fault Category: _____ NCR: Yes No DQA: _____ Date: _____

Resolution: _____ Disposition: _____ QA: N/C Closed: _____ Date: _____

NCR:		WORK ORDER NON-CONFORMANCE (NCR)						
DATE	STEP	Description of NC Section A	Corrective Action Section B			Verification Section C	Approval Chief Eng	Approval QC Inspector
			Initial Chief Eng	Action Description Chief Eng	Sign & Date			

NOTE: Date & initial all entries

Date: Wednesday, 03/09/2008 10:32:43 AM
User: Julie Lecocq

Process Sheet

Customer: CU-DAR001 Dart Helicopters Services

Drawing Name: AFT TUBE ASSEMBLY

Job Number: 41755

Part Number: D3391025

Job Number:



Seq. #:

Machine Or Operation:

Description :

or equivalent per
QSI 017

26.0

ALS41032225

Insert



Comment: Qty.: 12.0000 Each(s)/Unit Total : 12.0000 Each(s)

INSERT

or equivalent

Per QSI 017

M 109817

MM

27.0

AN3C4A

BOLT



Comment: Qty.: 6.0000 Each(s)/Unit Total : 6.0000 Each(s)

Bolt

Pick:

Qty Part Number Description Batch

2

AN3C4A

Bolt

M 110985

MM

28.0

AN3C5A

Bolt



Comment: Qty.: 4.0000 Each(s)/Unit Total : 4.0000 Each(s)

Bolt

M 110916

MM

29.0

AN960C10L

washer



Comment: Qty.: 10.0000 Each(s)/Unit Total : 10.0000 Each(s)

Inventory

Pick:

Qty Part Number Description Batch

2

AN960C10L

Washer

M 110267

MM

30.0

HAND FINISHING1

HAND FINISHING RESOURCE #1



Comment: SMALL & MEDIUM FAB RESOURCE 1

✓ 1-Install inserts as per Dwg D3391

2-Install Aft Cap as per Dwg D3391

A/R Sikaflex-241/-291 M109883

Sikaflex expiry date:

0911

MM

09-03-10

Q2

W/O:		WORK ORDER CHANGES					
DATE	STEP	PROCEDURE CHANGE	By	Date	Qty	Approval Chief Eng / Prod Mgr	Approval QC Inspector

Part No: _____ PAR #: _____ Fault Category: _____ NCR: Yes No DQA: _____ Date: _____

Resolution: _____ Disposition: _____ QA: N/C Closed: _____ Date: _____

NCR:		WORK ORDER NON-CONFORMANCE (NCR)						
DATE	STEP	Description of NC Section A	Corrective Action Section B			Verification Section C	Approval Chief Eng	Approval QC Inspector
			Initial Chief Eng	Action Description Chief Eng	Sign & Date			

NOTE: Date & initial all entries

Date: Wednesday, 03/09/2008 10:32:43 AM
User: Julie Lecocq

Process Sheet

Customer: CU-DAR001 Dart Helicopters Services

Drawing Name: AFT TUBE ASSEMBLY

Job Number: 41755

Part Number: D3391025

Job Number:



Seq. #:

Machine Or Operation:

Description :

31.0

QC5

INSPECT WORK TO CURRENT STEP



903.11

Comment: INSPECT WORK TO CURRENT STEP

32.0

PACKAGING 1

PACKAGING RESOURCE #1



(10)

Comment: PACKAGING RESOURCE #1

Identify and Stock

Location:

QRP 45923

9/13/12

SD

33.0

QC21

FINAL INSPECTION/W/O RELEASE



(1)

Comment: FINAL INSPECTION/W/O RELEASE

9/13/13

Job Completion



U 9.03.13


W/O:		WORK ORDER CHANGES					
DATE	STEP	PROCEDURE CHANGE	By	Date	Qty	Approval Chief Eng / Prod Mgr	Approval QC Inspector

Part No: _____ PAR #: _____ Fault Category: _____ NCR: Yes No DQA: _____ Date: _____

Resolution: _____ Disposition: _____ QA: N/C Closed: _____ Date: _____

NCR:		WORK ORDER NON-CONFORMANCE (NCR)						
DATE	STEP	Description of NC Section A	Corrective Action Section B			Verification Section C	Approval Chief Eng	Approval QC Inspector
			Initial Chief Eng	Action Description Chief Eng	Sign & Date			

NOTE: Date & initial all entries

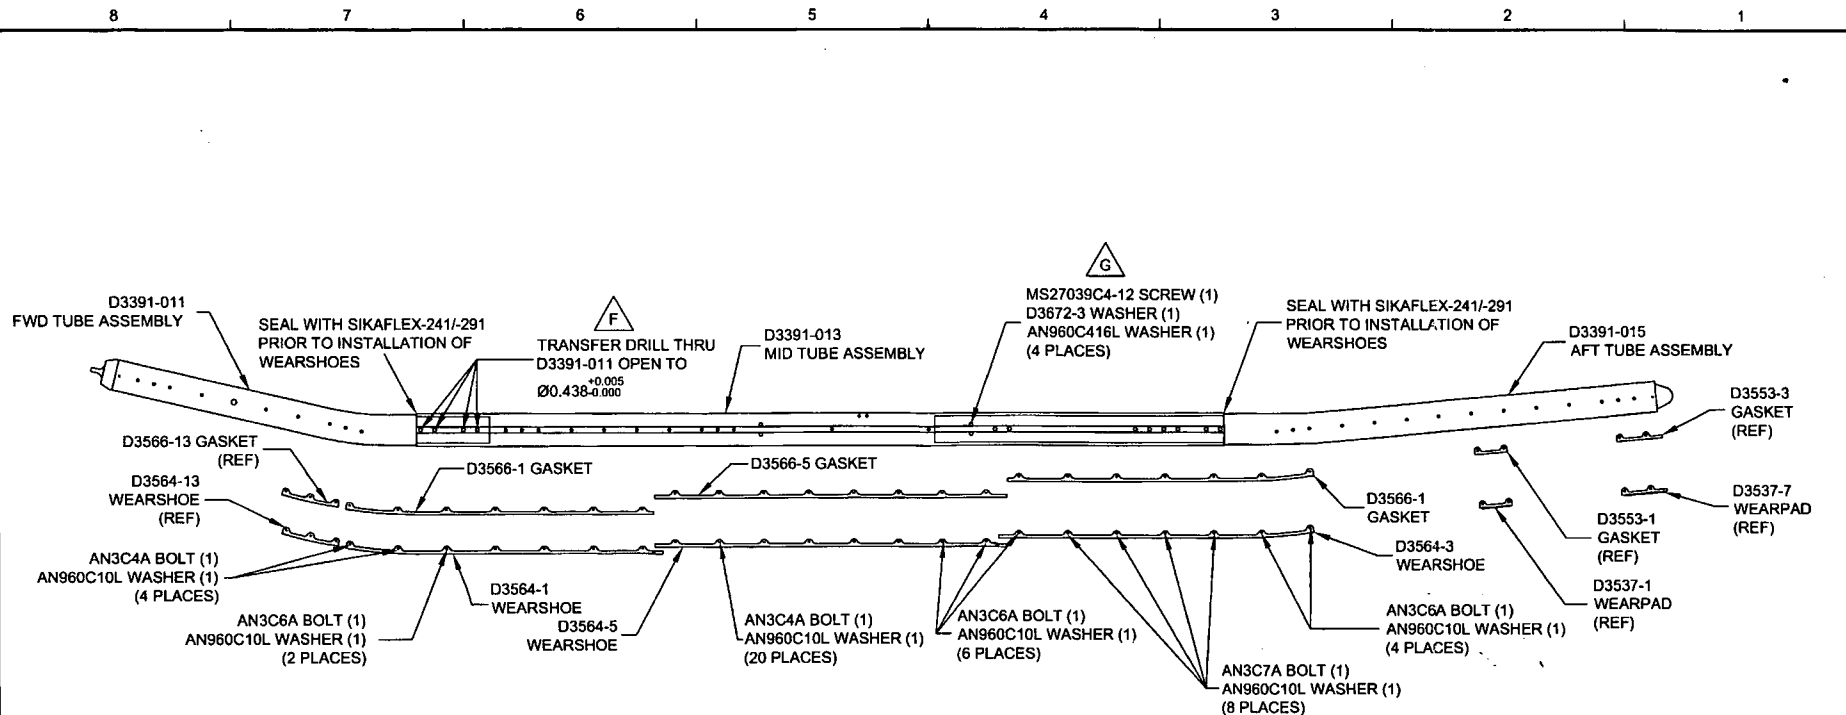

D3391-041 ASSEMBLY

RELEASED
07-11-06

D3391-041 FLOAT SKIDTUBE ASSEMBLY PARTS LIST

QTY	PART NUMBER	DESCRIPTION
1	D3391-041	FLOAT SKIDTUBE ASSEMBLY
1	D3391-011	FWD TUBE ASSEMBLY
1	D3391-013	MID TUBE ASSEMBLY
1	D3391-015	AFT TUBE ASSEMBLY
1	D3564-1	WEARSHOE
1	D3564-3	WEARSHOE
1	D3564-5	WEARSHOE
2	D3566-1	GASKET
1	D3566-3	GASKET
4	D3672-3	WASHER
24	AN3C4A	BOLT
12	AN3C6A	BOLT
8	AN3C7A	BOLT
44	AN960C10L	WASHER
4	MS27039C4-12	SCREW
4	AN960C416L	WASHER

GENERAL NOTES

- 1) FINISH: CHEMICAL CONVERSION COAT PER DART QSI 005 4.1
POWDER COAT WHITE (4.3.5.1) PER DART QSI 005 4.3
- 2) SPRAY INSIDE OF TUBE WITH A COAT OF LPS LABORATORIES "LPS-3" AFTER FINISH
AND AFTER INSTALLATION OF INSERTS. COAT ALL EXPOSED FASTENERS WITH
LPS LABORATORIES "LPS PROCYON" AFTER FINAL ASSEMBLY, CLEAN EXCESS
OFF POWDER COATING WITH MEK DEGREASER.
- 3) TOLERANCES: PER DART QSI 018 UNLESS OTHERWISE NOTED
- 4) UNITS: INCHES UNLESS OTHERWISE NOTED
- 5) USE DART DRILL TEMPLATE DT8217 TO LOCATE AND DRILL Ø0.297 SIZE HOLES
FOR WEARSHOE INSERTS. C'BORE AS NOTED AND INSTALL INSERTS EXCEPT
WHERE INDICATED.

G	REPLACE NAS INSERTS W/ AELS INSERTS SWITCH TO D3670-XXXX SPACERS FOR INSTALLING FLOAT BAGS, DWG REORGANIZED FOR CLARITY	DC	07.07.31
F	ADD SS WEARSHOE, GASKET REMOVE FWD SADDLE HOLE -011-021	PH	07.01.18
E	CHANGE TOLERANCE, EASE MANUFACTURE	PH	06.04.25
D	UPDATE TOLERANCE, CHANGE HOLE SIZE	PH	06.01.23
C	LENGTHEN AFT EXTENSION	PH	05.09.27
B	DRAWING UPDATES	PH	05.06.10
A	NEW ISSUE	PH	05.02.07
REV.	DESCRIPTION	BY	DATE
DESIGN			
DRAWN			
CHECKED			
MFG. APPR.			
APPROVED			
DE APPR.			
DATE	07.07.31		


DART AEROSPACE USA, INC
PORT HADLOCK, WA

DRAWING NO. D3391
REV. G
SHEET 1 OF 8

TITLE
412 FLOAT SKIDTUBE
NTS

COPYRIGHT © 2005 BY DART AEROSPACE USA, INC
THIS DOCUMENT IS PRIVATE AND CONFIDENTIAL AND IS SUPPLIED ON THE EXPRESS CONDITION THAT IT IS
NOT TO BE USED FOR ANY PURPOSE OR COPIED OR COMMUNICATED TO ANY OTHER PERSON WITHOUT
WRITTEN PERMISSION FROM DART AEROSPACE USA, INC.

SHOP COPY
RETURN TO
ENGINEERING
CONTROLLED COPY
SUBJECT TO AMENDMENT
WITHOUT NOTICE
WORK ORDER
NO. 117

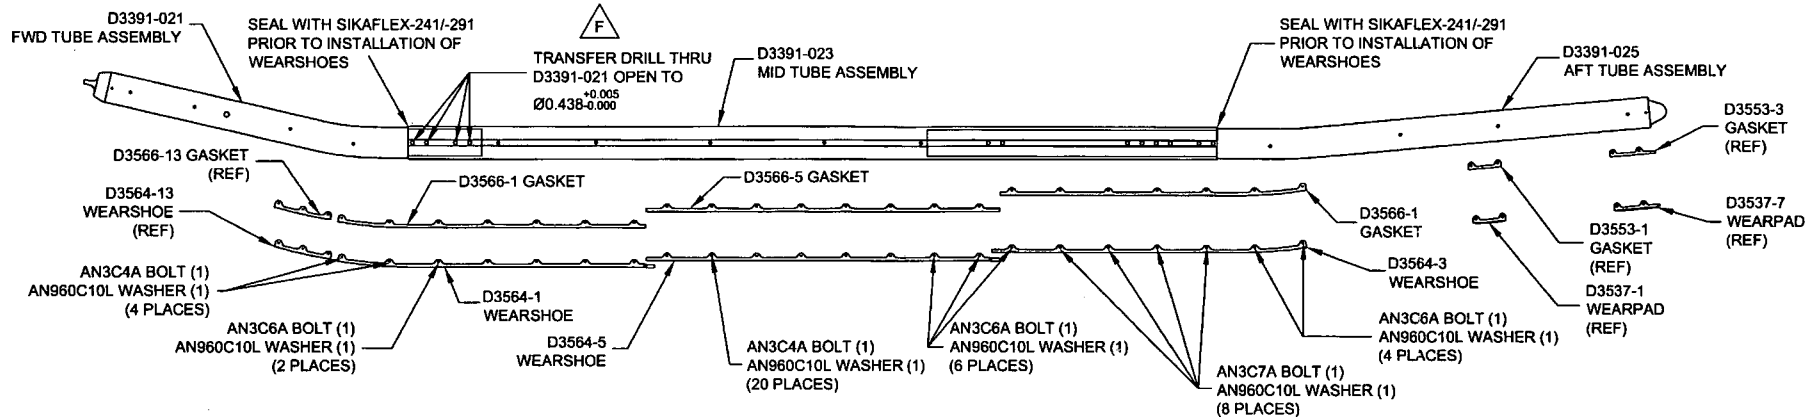

D3391-043 ASSEMBLY

RELEASED
07.11.94

D3391-043 FLOAT SKIDTUBE ASSEMBLY PARTS LIST


QTY	PART NUMBER	DESCRIPTION
X	D3391-043	FLOAT SKIDTUBE ASSEMBLY
1	D3391-021	FWD TUBE ASSEMBLY
1	D3391-023	MID TUBE ASSEMBLY
1	D3391-025	AFT TUBE ASSEMBLY
1	D3564-1	WEARSHOE
1	D3564-3	WEARSHOE
1	D3564-5	WEARSHOE
2	D3566-1	GASKET
2	D3566-5	GASKET
24	AN3C4A	BOLT
12	AN3C6A	BOLT
8	AN3C7A	BOLT
44	AN960C10L	WASHER

GENERAL NOTES


- 1) FINISH: CHEMICAL CONVERSION COAT PER DART QSI 005 4.1
POWDER COAT WHITE (4.3.5.1) PER DART QSI 005 4.3
- 2) SPRAY INSIDE OF TUBE WITH A COAT OF LPS LABORATORIES "LPS-3" AFTER FINISH AND AFTER INSTALLATION OF INSERTS. COAT ALL EXPOSED FASTENERS WITH LPS LABORATORIES "LPS PROCYON" AFTER FINAL ASSEMBLY, CLEAN EXCESS OFF POWDER COATING WITH MEK DEGREASER.
- 3) TOLERANCES: PER DART QSI 018 UNLESS OTHERWISE NOTED
- 4) UNITS: INCHES UNLESS OTHERWISE NOTED
- 5) USE DART DRILL TEMPLATE DT8217 TO LOCATE AND DRILL Ø0.297 SIZE HOLES FOR WEARSHOE INSERTS. C'BORE AS NOTED AND INSTALL INSERTS EXCEPT WHERE INDICATED.

DESIGN	HA	DART AEROSPACE USA, INC	
DRAWN	JLC	PORT HADLOCK, WA	
CHECKED	JLC	DRAWING NO.	REV. G
MFG. APPR.	JLC	D3391	SHEET 2 OF 8
APPROVED	JLC	TITLE	SCALE
DE APPR.	JLC	412 FLOAT SKIDTUBE	NTS
DATE	07.07.31	<small>COPYRIGHT © 2005 BY DART AEROSPACE USA, INC THIS DOCUMENT IS PRIVATE AND CONFIDENTIAL, AND IS SUPPLIED ON THE EXPRESS CORON THAT IT IS NOT TO BE USED FOR ANY PURPOSE OR COMMUNICATED TO ANY OTHER PERSON WITHOUT WRITTEN PERMISSION FROM DART AEROSPACE USA, INC.</small>	


SHOP COPY
RETURN TO
ENGINEERING
UNCONTROLLED COPY
SUBJECT TO AMENDMENT
WITHOUT NOTICE
WORK ORDER
NO. 41785

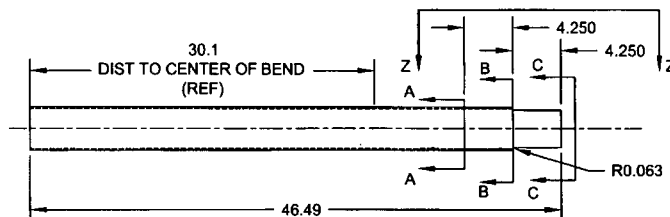


D3391-1 CUTTING DETAIL
(MAKE FROM D6013-047 SKIDTUBE MATERIAL)

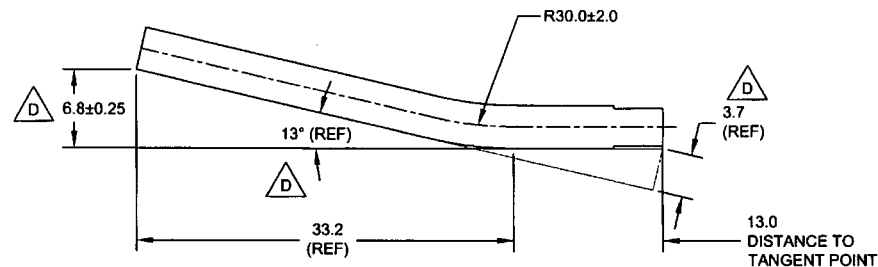


D3391-011/-021 BENDING DETAIL
(MAKE FROM D3391-1)

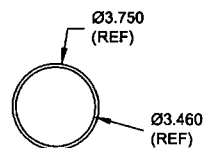


SECTION A-A
(SCALE 1:5)

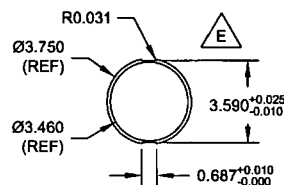

SECTION B-B
(SCALE 1:5)

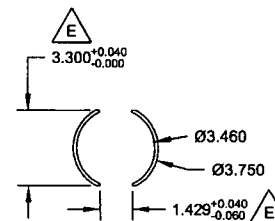

SECTION C-C
(SCALE 1:5)

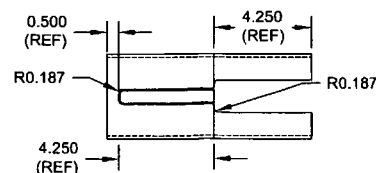


VIEW Z-Z
(SCALE 1:5)

RELEASED
07.11.06 10P

SHOP COPY
RETURN TO
ENGINEERING
UNCONTROLLED COPY
SUBJECT TO AMENDMENT
WITHOUT NOTICE
NO. 1755

DESIGN		DART AEROSPACE USA, INC	
DRAWN		PORT HADLOCK, WA	
CHECKED		DRAWING NO.	REV. G
MFG. APPR.		D3391	SHEET 3 OF 8
APPROVED		TITLE	SCALE
DE APPR.		412 FLOAT SKIDTUBE	1:10
DATE	07.07.31	<small>COPYRIGHT © 2005 BY DART AEROSPACE USA, INC THIS DOCUMENT IS PRIVATE AND CONFIDENTIAL AND IS SUPPLIED ON THE EXPRESS CONDITION THAT IT IS NOT TO BE USED FOR ANY PURPOSE OR COPIED OR COMMUNICATED TO ANY OTHER PERSON WITHOUT WRITTEN PERMISSION FROM DART AEROSPACE USA, INC.</small>	

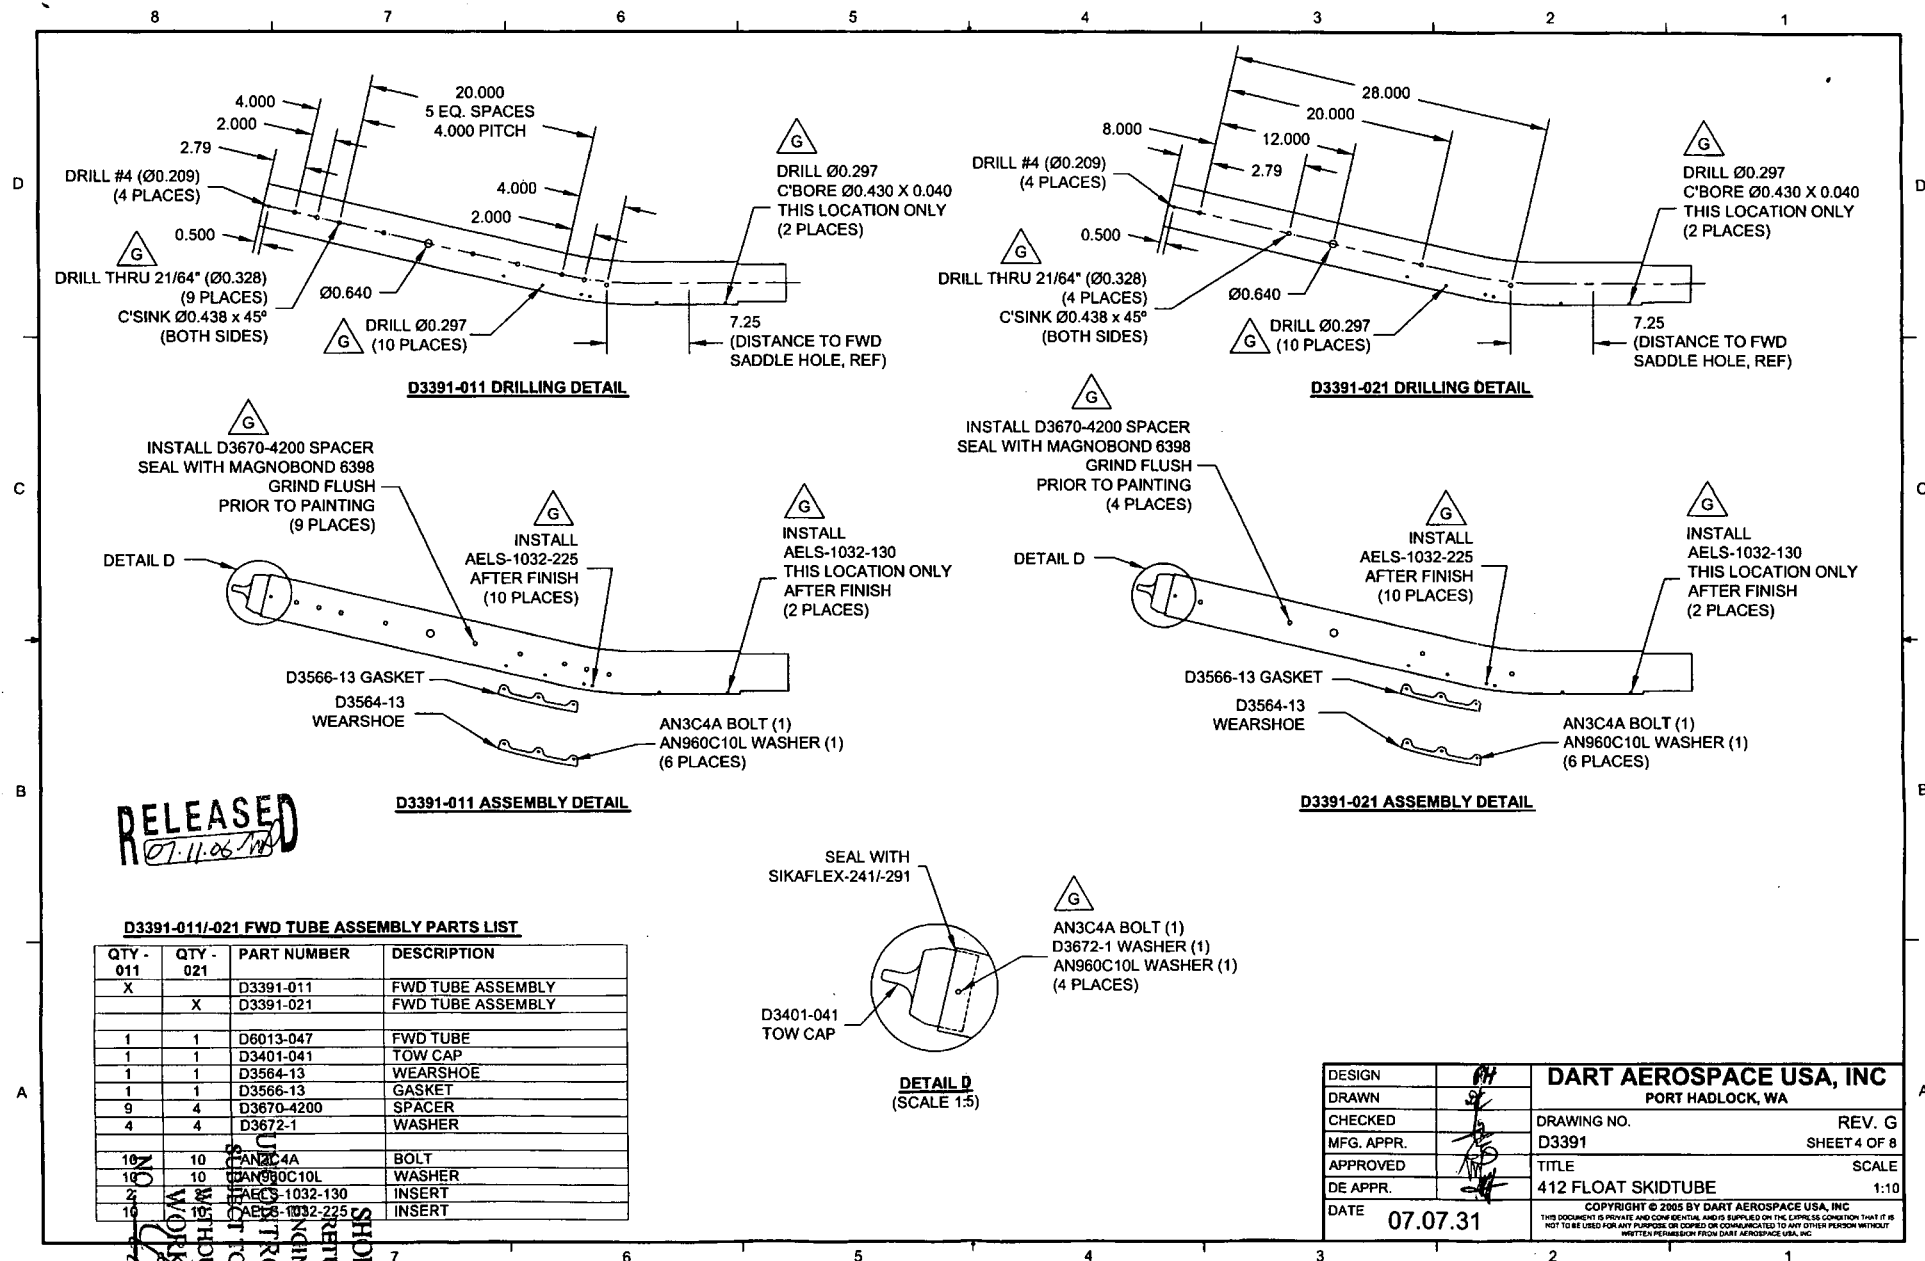

8

7

6


5

4

3


2

1

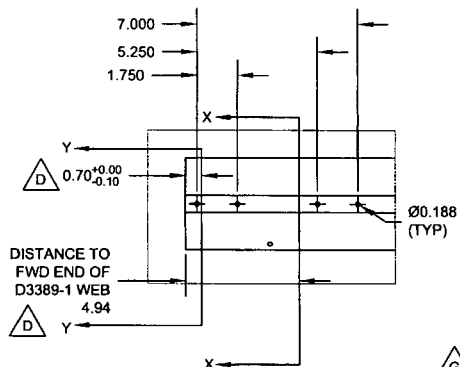


DETAIL J
(SCALE 1:5)


DRILL THRU 21/64" (Ø0.328)
C/SINK Ø0.438 X 45° (BOTH SIDES)
(12 PLACES)

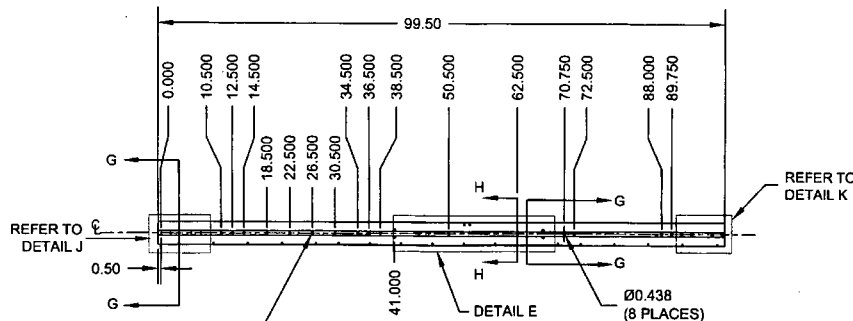

D3391-013 ASSEMBLY DETAIL

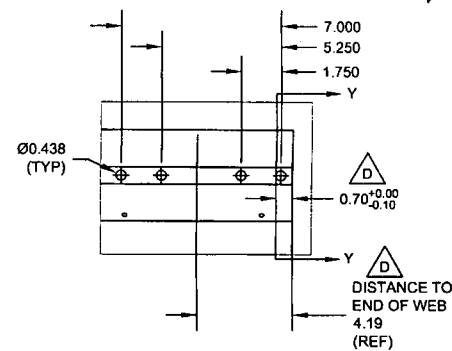


DETAIL K
(SCALE 1:5)

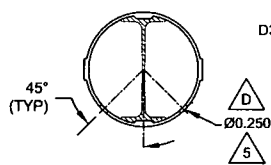


SECTION G-G
(SCALE 1:4)


INSTALL
D3681-1 SPACER

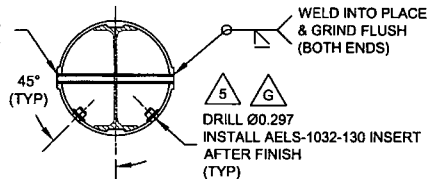

SECTION H-H
(SCALE 1:4)

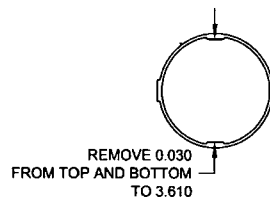


SECTION X-X
(SCALE 1:4)

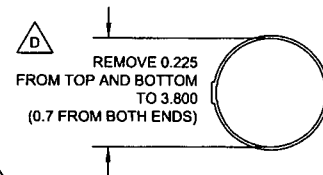


SECTION Y-Y
(SCALE 1:4)

DRILL Ø0.297
INSTALL AELS-1032-130 INSERT
MS27039C1-09 SCREW
D3672-1 WASHER
AN960C10L WASHER
AFTER FINISH
(TYP 4 PLACES)

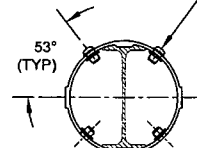

SECTION M-M
(SCALE 1:4)


DRILL Ø0.250
(TYP 4 PLACES)



SECTION LL-LL
(SCALE 1:4)


D3391-013 MID TUBE ASSEMBLY PARTS LIST

QTY -013	PART NUMBER	DESCRIPTION
X	D3391-013	MID TUBE ASSEMBLY
1	D2500-1-100	EXTRUSION
1	D3389-1	WEB
12	D3681-1	SPACER
4	D3672-1	WASHER
4	D3672-3	WASHER
24	AELS-1032-130	INSERT
4	ALS4-428-165	INSERT
4	AN960C10L	WASHER
4	AN960C416L	WASHER
4	MS27039C1-09	SCREW
4	MS27039C4-08	SCREW

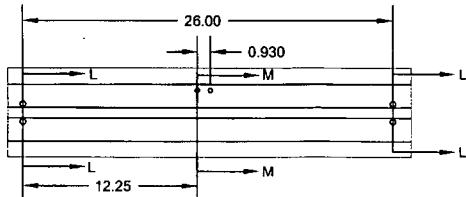

DETAIL E
(SCALE 1:8)

DRILL Ø0.391
INSTALL ALS4-428-165 INSERT
MS27039C4-08 SCREW
D3672-3 WASHER
AN960C416L WASHER
AFTER FINISH
(TYP 4 PLACES)

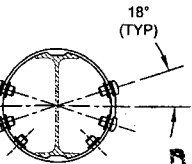

SECTION L-L
(SCALE 1:4)

D3391-013 MID TUBE ASSEMBLY

- 1) MATERIAL: MAKE FROM D2500-1-100 EXTRUSION
- 2) INSTALL D3389-1 WEB TO OUTER TUBE USING SIKAFLEX-241/291 PER QSI 015
- 3) WELDING: PER DART QSI 004

DESIGN	PH
DRAWN	DP
CHECKED	DP
MFG. APPR.	DP
APPROVED	DP
DE APPR.	DP
DATE	07.07.31






DART AEROSPACE USA, INC
PORT HADLOCK, WA

DRAWING NO. D3391
REV. G
SHEET 5 OF 8
TITLE 412 FLOAT SKIDTUBE
SCALE 1:20

COPYRIGHT © 1985 BY DART AEROSPACE USA, INC
THIS DOCUMENT IS PRIVATE AND CONFIDENTIAL AND IS SUPPLIED ON THE EXPRESS CONDITION THAT IT IS NOT TO BE USED FOR ANY PURPOSE, OR COPIED OR REPRODUCED IN ANY MANNER WITHOUT WRITTEN PERMISSION FROM DART AEROSPACE USA, INC.

RELEASED
07.11.2017

SHOP COPY
RETURN TO
ENGINEERING
CONTROLLED COPY
SUBJECT TO AMENDMENT
WITHOUT NOTICE
WORK ORDER
11/1/85

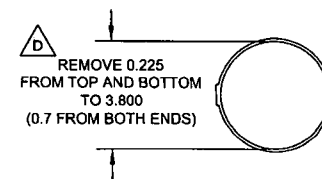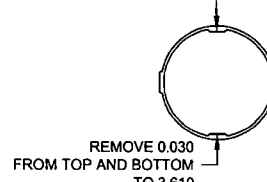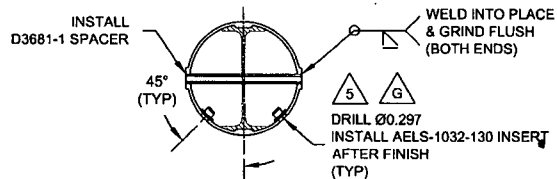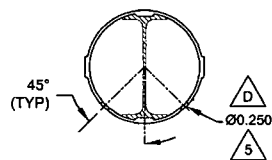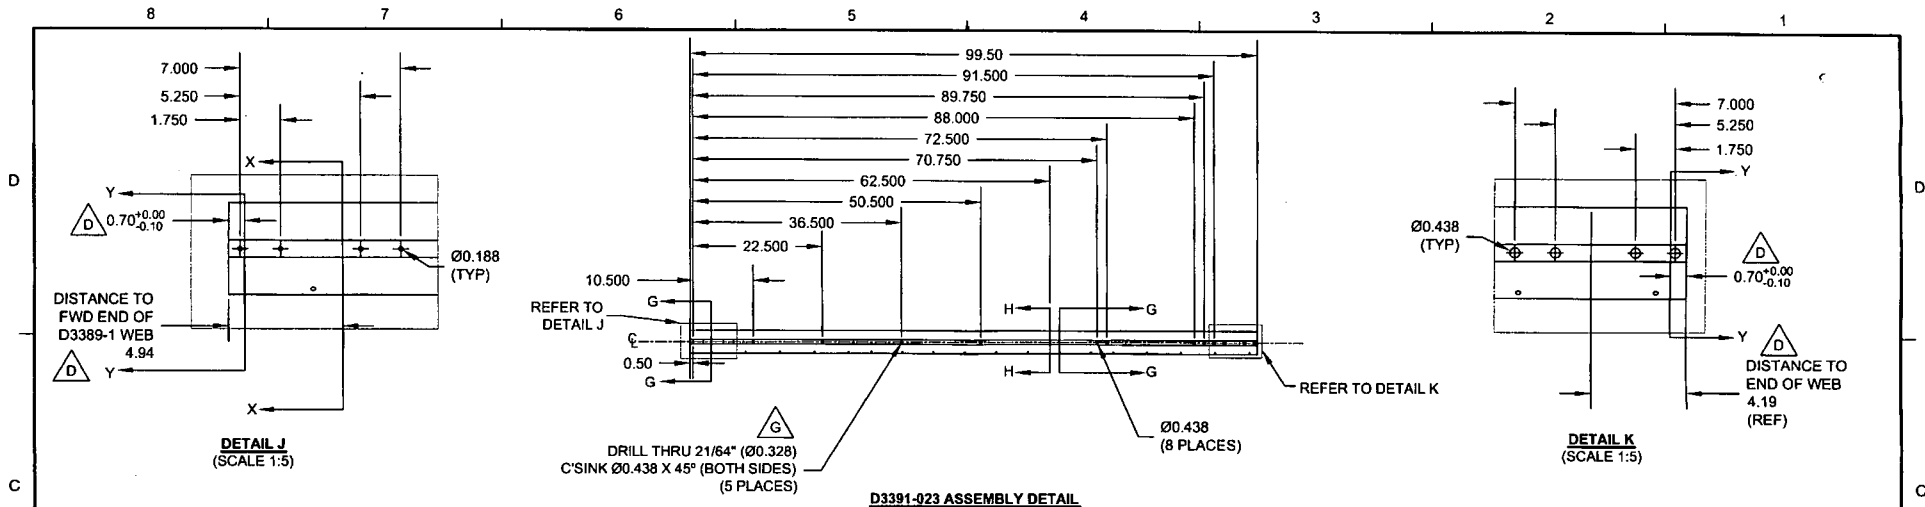

D3391-023 MID TUBE ASSEMBLY PARTS LIST

QTY - 023	PART NUMBER	DESCRIPTION
X	D3391-023	MID TUBE ASSEMBLY
1	D2500-1-100	EXTRUSION
1	D3389-1	WEB
5	D3681-1	SPACER
20	AELS-1032-130	INSERT

D3391-023 MID TUBE ASSEMBLY

- 1) MATERIAL: MAKE FROM D2500-1-100 EXTRUSION
- 2) INSTALL D3389-1 WEB TO OUTER TUB USING SIKAFLEX-241/291 PER QSI 015
- 3) WELDING: PER DART QSI 004


RELEASED
07.11.06/11

DESIGN	PH	DART AEROSPACE USA, INC
DRAWN	DE	PORT HADLOCK, WA
CHECKED	h	DRAWING NO. D3391
MFG. APPR.	RD	REV. G
APPROVED	SH	SHEET 6 OF 8
DE APPR.		TITLE 412 FLOAT SKIDTUBE
DATE	07.07.31	SCALE 1:20

COPYRIGHT © 2005 BY DART AEROSPACE USA, INC
THIS DOCUMENT IS PRIVATE AND CONFIDENTIAL AND IS SUPPLIED ON THE EXPRESS CONDITION THAT IT IS NOT TO BE USED FOR ANY PURPOSE OR COPIED OR COMMUNICATED TO ANY OTHER PERSON WITHOUT WRITTEN PERMISSION FROM DART AEROSPACE USA, INC

SHOP COPY
RETURN TO
ENGINEERING
SUBJECT TO AMENDMENT
WITHOUT NOTICE
WORK ORDER
11/11/06



8 7 6 5 4 3 2 1

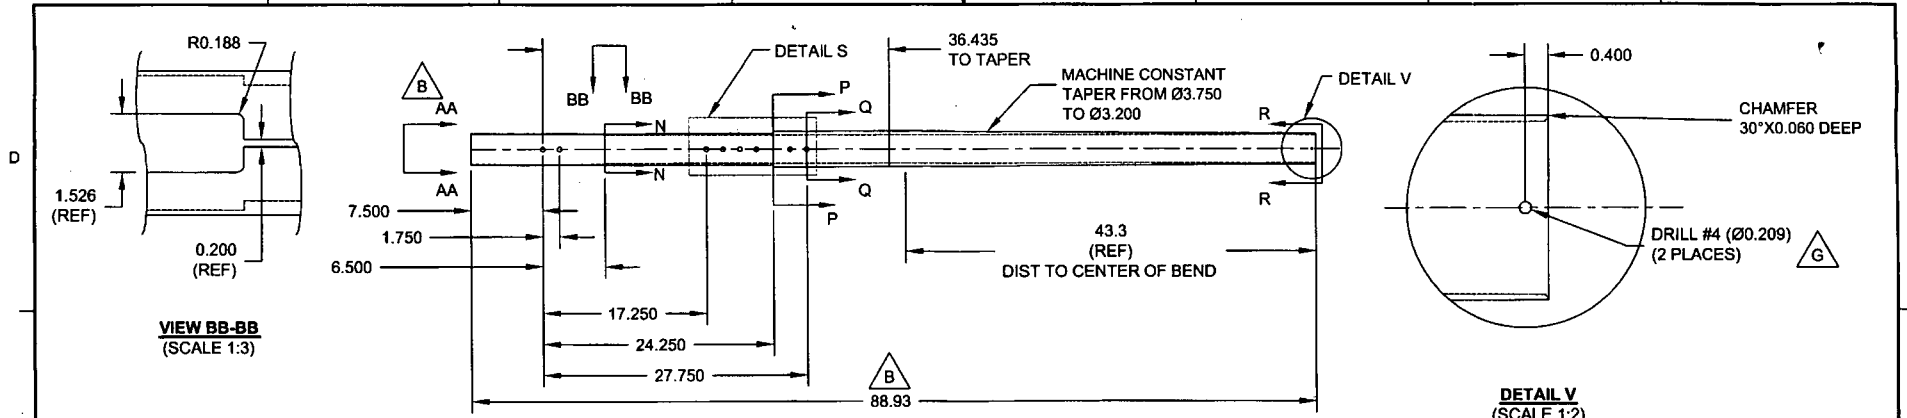

VIEW BB-BB
(SCALE 1:3)

D3391-3 AFT DRILLING AND CUTTING DETAIL
(MAKE FROM D6014-090 SKIDTUBE MATERIAL)

DETAIL V
(SCALE 1:2)

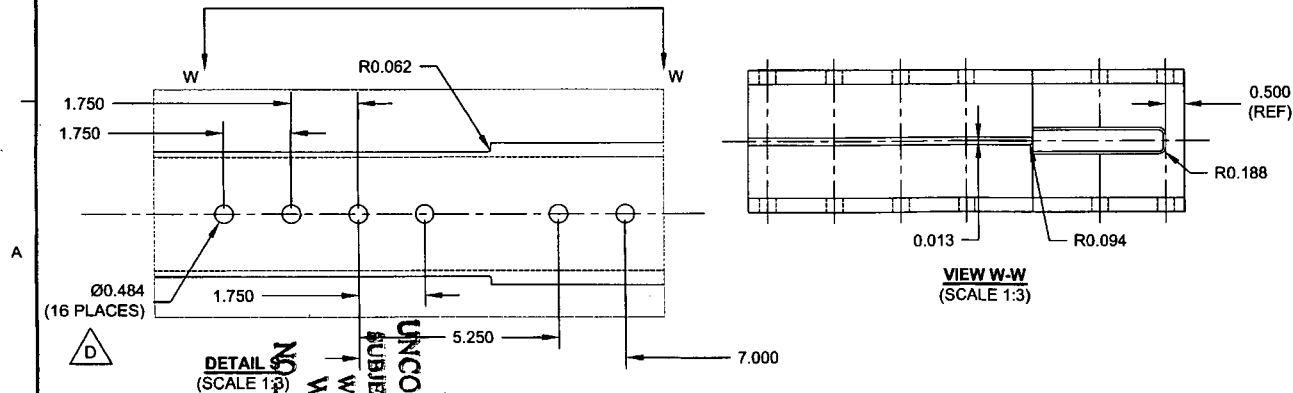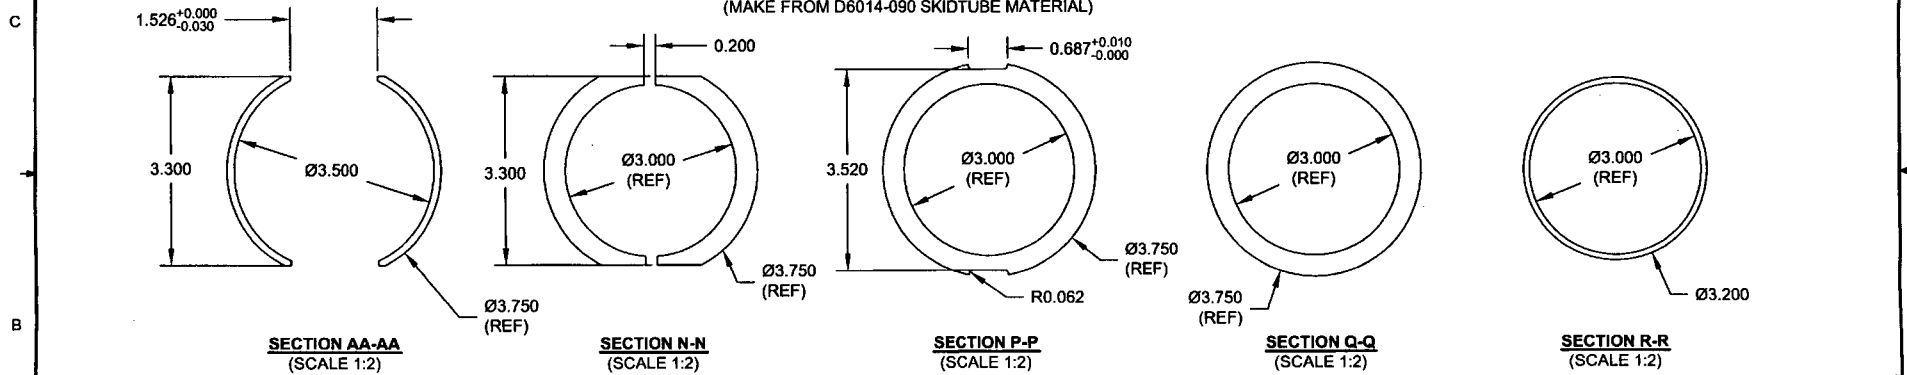


DETAIL S
(SCALE 1:3)

RELEASED
07-11-06


DESIGN		DART AEROSPACE USA, INC	
DRAWN	PH	PORT HADLOCK, WA	
CHECKED	DC	DRAWING NO.	REV. G
MFG. APPR.	SE	D3391	SHEET 7 OF 8
APPROVED	SE	TITLE	SCALE
DE APPR.	SE	412 FLOAT SKIDTUBE	1:12
DATE	07.07.31	COPYRIGHT © 2005 BY DART AEROSPACE USA, INC THIS DOCUMENT IS PRIVATE AND CONFIDENTIAL AND IS SUPPLIED ON THE EXPRESS CONDITION THAT IT IS NOT TO BE USED FOR ANY PURPOSE OR COPIED OR COMMUNICATED TO ANY OTHER PERSON WITHOUT WRITTEN PERMISSION FROM DART AEROSPACE USA, INC.	

NO
 WORK ORDER
 UNCONTROLLED COPY
 SUBJECT TO AMENDMENT
 WITHOUT NOTICE
 RETURN TO
 ENGINEERING
 SHOP COPY

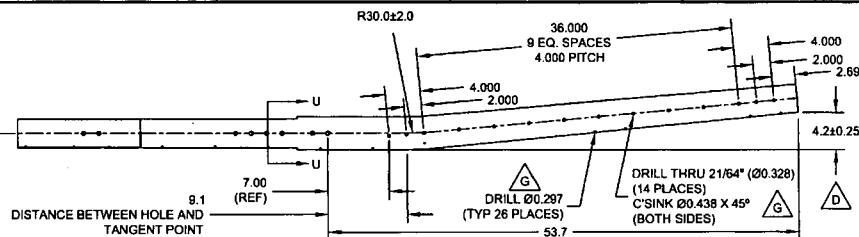


D3391-015 BENDING AND DRILLING DETAIL
(SEE C'BORE DETAIL BELOW)

INSTALL D3670-4200 SPACER
SEAL WITH MAGNOBOND 6398
GRIND FLUSH
PRIOR TO PAINTING
(14 PLACES)

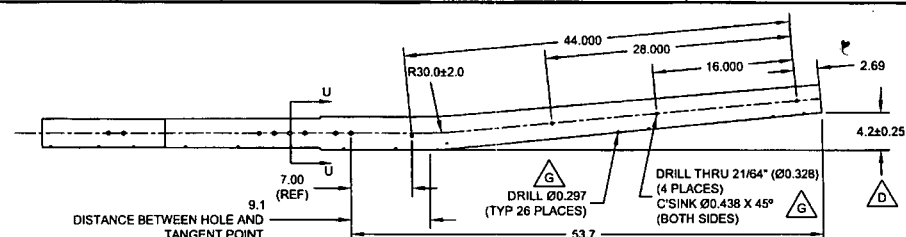


D3391-025 BENDING AND DRILLING DETAIL
(SEE C'BORE DETAIL BELOW)

INSTALL D3670-4200 SPACER
SEAL WITH MAGNOBOND 6398
GRIND FLUSH
PRIOR TO PAINTING
(4 PLACES)


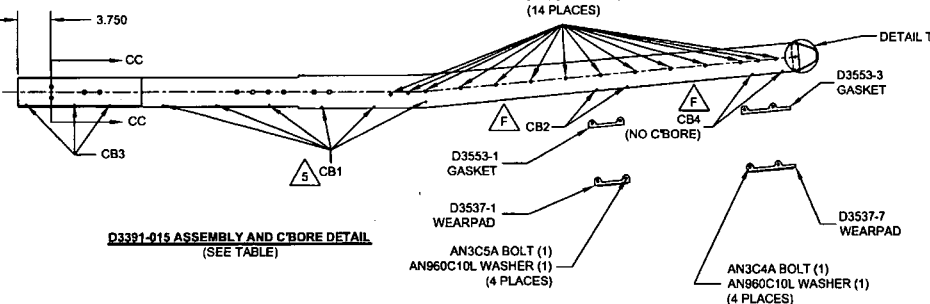


D3391-015 ASSEMBLY AND C'BORE DETAIL
(SEE TABLE)

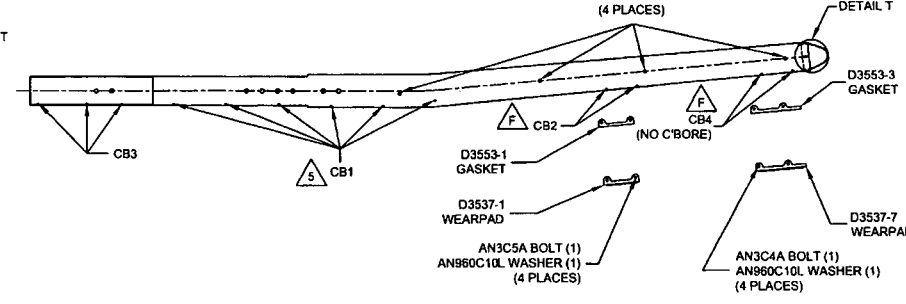


D3391-025 ASSEMBLY AND C'BORE DETAIL
(SEE TABLE)

QTY - 015	QTY - 025	PART NUMBER	DESCRIPTION
X	X	D3391-015	AFT TUBE ASSEMBLY
X	X	D3391-025	AFT TUBE ASSEMBLY
1	1	D6014-090	AFT TUBE
1	1	D2646	AFT CAP
1	1	D3537-1	WEARPAD
1	1	D3537-7	WEARPAD
1	1	D3553-1	GASKET
1	1	D3553-3	GASKET
14	4	D3670-4200	SPACER
2	2	D3672-1	WASHER
14	14	AELS-1032-130	INSERT
12	12	AELS-1032-225	INSERT
4	4	ALS4-428-165	INSERT
6	6	AN3C4A	BOLT
4	4	AN3C5A	BOLT
10	10	AN960C10L	WASHER

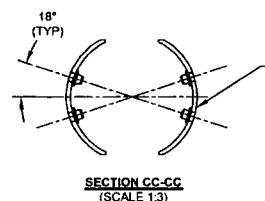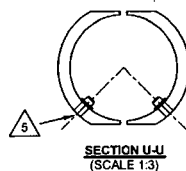

DRILL Ø0.391
C'BORE Ø0.516 X 0.040 DEEP
INSTALL ALS4-428-165 INSERT (1)
(4 PLACES)

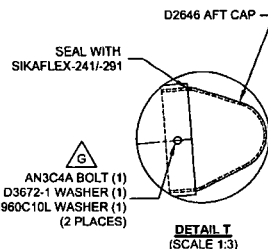

RELEASED
07.11.06

C'BORE HOLES MARKED CB1-CB4 AS FOLLOWS AND
INSTALL AELS-1032-XXX AFTER FINISH AS NOTED

HOLES MARKED	QTY D3391-015	QTY D3391-025	C'BORE	PIN
CB1	12	12	Ø0.430 X 0.170	AELS-1032-225
CB2	4	4	Ø0.430 X 0.170	AELS-1032-130
CB3	8	8	Ø0.430 X 0.170	AELS-1032-130
CB4	4	4	NONE	AELS-1032-130

DESIGN	HH	DART AEROSPACE USA, INC
DRAWN	OK	PORT HADLOCK, WA
CHECKED	OK	DRAWING NO. REV. G
MFG. APPR.	OK	D3391 SHEET 8 OF 8
APPROVED	OK	TITLE SCALE
DE APPR.	OK	412 FLOAT SKIDTUBE 1:12
DATE	07.07.31	COPYRIGHT © 2005 BY DART AEROSPACE USA, INC

NO
WORK ORDER
SUBJECT TO AMENDMENT
WITHOUT NOTICE
ENGINEERING
RETURN TO
SHOP COPY

DAR Aerospace LTD		Work Order: B 41755
Description: Float Skidtube (412)		Part Number: D3391-3
Inspection Dwg: D3391	Rev: G	Page 1 of 1

FIRST ARTICLE INSPECTION CHECKLIST

☒ First Article ☐ Prototype

Drawing Dimension	Tolerance	Actual Dimension	Accept	Reject	Method of Inspection	Comments
14.000	+/-0.010	14.000	✓			
3.500	+/-0.010	3.490	✓			
88.93	+/-0.030	88.93	✓			
44.995	+/-0.030	44.925	✓			
3.200	+/-0.010	3.210	✓			
1.526	+0.000/-0.030	1.510	✓			
0.200	+/-0.010	.200	✓			
7.500	+/-0.010	7.499	✓			
27.750	+/-0.010	27.750	✓			
31.750	+/-0.010	31.750	✓			
35.250	+/-0.010	35.250	✓			
3.300	+/-0.010	3.300	✓			
0.200	+/-0.010	.200	✓			
3.520	+/-0.010	3.520	✓			
0.687	+0.010/-0.000	.687	✓			
R0.062	+/-0.010	R.062	✓			
Ø0.484	+0.005/-0.001	Ø0.488	✓			

Measured by: a.m./H.A.08/10 ¹³	Audited by: gml	Prototype Approval:	N/A
Date: 08-09-11	Date: 08/09/28	Date:	N/A

Rev	Date	Change	Revised by	Approved
A	06.04.24	New Issue P/O D3391-015/-025	KJ/JLM	
B	06.06.19	Dwg revision update	KJ/JLM	
C	07.04.20	Ø0.208 dimension removed	KJ/JLM	
D	07.09.06	0.400 dimension removed	KJ/JLM	
E	07.11.23	Dwg Rev. updated	KJ/EC/DD	